

ARBORIST REPORT

February 16, 2023
Rev. February 23, 2023
6484.00

PROJECT

380 N. First St.
San Jose, CA

PREPARED FOR

MSASA Properties LLC

PREPARED BY

HMH
1570 Oakland Road
San Jose, CA 95131
William Sowa
ISA Certified Arborist #WE-12270A



TABLE OF CONTENTS

	<u>Page</u>
Table of Contents	1
Introduction and Overview	2
Methodology	2
Summary of Findings	2
General Observations and Recommendations	3
Recommendations for Tree Protection During Construction	5
Maintenance Recommendations for Trees to Remain	6
Terms and Conditions	8
Exhibit A – Existing Tree Map	9
Table 1 - Tree Quantity Summary	10
Table 2 - Tree Evaluation Summary	11
Tree Protection Detail	14
Tree Photographs	15

INTRODUCTION AND OVERVIEW

HMH was contracted to complete a survey, assessment and arborist report for trees located within the limit of work illustrated on Exhibit A. The project site encompasses a .48 acre commercial parcel. There are residential sites to the east and west, a commercial site to the south and a Santa Clara county Transit site and railroad line to the north. Our scope of services includes locating, measuring DBH, assessing, and photographing the condition of all trees within the limit of work. Disposition and health recommendations are based on current site conditions. Site development/design may affect the preservation suitability. In addition, trees located outside the limit of work may be included if they may potentially be impacted by development of the site. These trees will not be measured, nor health assessed due to limited access. Tree locations are approximate, and their exact location should be determined by a licensed land surveyor. It should not be assumed that all trees inventoried are owned by the property owner. Check city and/or county codes for regulations regarding trees in the public right of way, setbacks, and/or easements.

METHODOLOGY

Our tree survey work is a deliberate and systematic methodology for cataloging trees on site:

1. Identify each tree species.
2. Note each tree's location on a site map.
3. Measure each trunk circumference at 4.5' above grade per ISA standards.
4. Evaluate the health and structure of each tree using the following numerical standard:
 - 5 - A healthy, vigorous tree, reasonably free of disease, with good structure and form typical of the species.*
 - 4 - A tree with slight decline in vigor, small amount of twig dieback, minor structural defects that could be corrected.*
 - 3 - A tree with moderate vigor, moderate twig and small branch dieback, thinning of crown, poor leaf color, moderate structural defects that may be mitigated with care.*
 - 2 - A tree in decline, epicormic growth, extensive dieback of medium to large branches, significant structural defects that cannot be abated.*
 - 1 - A tree in severe decline, dieback of scaffold branches and or trunk, mostly epicormic growth; extensive structural defects that cannot be abated.*
 - 0 - Tree is dead.*

SUMMARY OF FINDINGS

HMH conducted a tree inventory of 22 trees located within the limit of work outlined in Exhibit A. Twelve (12) of the trees inventoried are classified as ordinance-sized trees under the City of San Jose Tree Removal permit.

An ordinance-size tree is:

Single Trunk - 38 inches or more in circumference at 4 ½ feet above ground; or

Multi-trunk - The combined measurements of each trunk circumference (at 4 ½ feet above ground) add up to 38 inches or more.

Table 1 - Tree Quantity Summary summarizes tree quantities by both species and size. Each species that was inventoried as part of this scope is included. This is a useful tool for analyzing the mixture of trees as part of the project. The size table is useful when calculating mitigation requirements in the case of tree removal as well as aiding in determining tree maturity.

Table 2 - Tree Evaluation Summary lists each tree number, botanical name, common name, DBH, circumference, ordinance trees, health rating, preservation suitability, general notes and observations and recommendations.

See Exhibit A for Existing Tree Locations

See Table 1 for Tree Quantity Summary by species and size.

See Table 2 for Tree Evaluation Summary for sizes, notes and recommendations regarding each tree.

GENERAL OBSERVATIONS AND RECOMMENDATIONS

Species: *Ailanthus altissima* (Tree of Heaven)

Quantity: 6

Tree Numbers: 17-22

Observations / Recommendations:

There are six Trees of Heaven growing adjacent to the property fence that seem to either be on the property or are partly on the property. All of these trees are in poor health and shape. Tree of Heaven is an invasive species according to the California Invasive Plant Council. They spread easily through seeds and suckers from their creeping roots. There are many suckers growing around these trees. They also have allelopathic properties which suppress other plants growing nearby. These trees and all of the roots and suckers should be removed to prevent further spread.

Species: *Ceratonia siliqua* (Carob)

Quantity: 3

Tree Numbers: 6-8

Observations / Recommendations:

There are three Carob trees growing next to a perimeter wall/fence that are in moderate health and shape. They are all large specimens that have many surface roots and are crowded by the adjacent wall/fence with a parking lot on the opposite side. Tree 6 has a visible hole and sounds hollow. Tree 8 has an area of decay.

Species: *Citrus sp.* (Citrus)

Quantity: 4

Tree Numbers: 11-14

Observations / Recommendations:

There are four citrus trees growing in a raised planter along the side of the property. Trees 11, 12, and 14 are in moderate health and shape with some crown dieback. Tree 13 appears to have so much dieback it is in decline and is recommended for removal. If any of these trees are to be retained, the raised soil level should be maintained.

Species: *Ficus benjamina* (Weeping Fig)

Quantity: 1

Tree Number: 9

Observations / Recommendations:

The Weeping fig is in poor health and shape. Most of the crown is dead and it has signs of stress and structural defects.

Species: *Persea americana* (Avocado)

Quantity: 2

Tree Numbers: 4-5

Observations / Recommendations:

There are two avocado trees in the parking area that are in moderate shape and condition. They appear to be shaded by the nearby Carob tree and do not seem to be thriving in their current location. There also appears to be some damage from vehicles.

Species: *Platanus x hispanica* (London Plane Tree)

Quantity: 2

Tree Numbers: 1-2

Observations / Recommendations:

There are 2 street trees that are in moderate health and shape. Both trees are in tree grates that should be inspected by the city because the trees have started growing over them.

Species: *Prunus cerasifera* (Purpleleaf Plum)

Quantity: 1

Tree Number: 3

Observations / Recommendations:

There is a small Purpleleaf Plum that is in moderate health and shape. There is a creeping cactus that has grown up into the tree that should be removed if this tree is to be retained.

Species: *Prunus sp.* (Cherry)

Quantity: 1

Tree Number: 10

Observations / Recommendations:

There is a small cherry tree that is in moderate health and shape in a raised planter on the side of the property. It is leaning away from the adjacent citrus tree that is crowding it. There are other cherry trees in the planter, but they are all very small and were not included. If this tree is to be retained, the raised soil level should be maintained.

Species: *Pyrus sp.* (Pear)

Quantity: 1

Tree Number: 15

Observations / Recommendations:

There is a pear tree in the raised planter that is in moderate health and shape. It is being shaded by the adjacent holly oak and is leaning away from it. If this tree is to be retained, the raised soil level should be maintained.

Species: *Quercus ilex* (Holly Oak)

Quantity: 1

Tree Number: 16

Observations / Recommendations:

There is a large holly oak in the raised planter that is in moderate health and shape. The tree is heavily infested by black sooty mold. The upper branches of the tree appear to be overgrown and are weighted at the ends. If this tree is to be retained, structural pruning is recommended as well as treating the black sooty mold. The raised soil level should be maintained as well.

RECOMMENDATIONS FOR TREE PROTECTION DURING CONSTRUCTION

Site preparation: All existing trees shall be fenced within or at the drip line (foliar spread) of the tree. Depending on the location of the tree the fencing may not be able to be at the dripline. Examples of this would be public right of way, near property lines or around existing structures to remain. Where complete drip line fencing is not possible, the addition of straw waddles and orange snow fencing wrapping the trunk shall be installed per the tree protection detail. The fence should be a minimum of six feet high, made of galvanized 11-gauge wire mesh with galvanized posts or any material superior in quality. A tree protection zone (TPZ) sign shall be affixed to fencing at appropriate intervals as determined by the arborist on site. See tree protection detail for additional information, including tree protection zone sign. If the fence is within the drip line of the trees, the foliar fringe shall be raised to offset the chance of limb damage from active construction.

Active Construction: All contractors, subcontractors and other personnel shall be warned that encroachment within the fenced area and dripline is prohibited without the consent of the certified arborist on the job. This includes, but is not limited to, storage of lumber and other materials, disposal of paints, solvents or other noxious materials, parked cars, grading equipment or other heavy equipment. If construction activity needs to happen in the TPZ the fence can be moved temporarily for delivery of construction materials. The contractor should make accommodations to off load items such as trusses, timber, plasterboard, wallboard, concrete, gypsum board, flooring, roofing or any other heavy construction material outside the foliar spread of the tree so there is no heavy equipment needed that could cause damage to the canopy of the tree or compact the root zone. The tree protection fencing should be reestablished per the plans and details immediately after any activity through the TPZ. Penalties, based on the cost of remedial repairs and the evaluation guide published by the International Society of Arboriculture, shall be assessed for damages to the trees.

Grading/excavating: All grading plans that specify grading within the drip line of any tree, or within the distance from the trunk as outlined in the site preparation section above when said distance is outside the drip line, shall first be reviewed by a certified arborist. Provisions for aeration, drainage, pruning, tunneling beneath roots, root pruning or other necessary actions to protect the trees shall be outlined by an arborist. If trenching is necessary within the area as described above, said trenching shall be undertaken by hand labor and dug directly beneath the trunk of the tree. All roots 2 inches or larger shall be tunneled under and other roots shall be cut smoothly to the trunk side of the trench. The trunk side should be draped immediately with two layers of untreated burlap to a depth of 3 feet from the surface. The burlap shall be soaked nightly and left in place until the trench is back filled to the original level. An arborist shall examine the trench prior to back filling to ascertain the number and size of roots cut, so as to suggest the necessary remedial repairs.

Remedial repairs: An arborist shall have the responsibility of observing all ongoing activities that may affect the trees and prescribing necessary remedial work to ensure the health and stability of the trees. This includes, but is not limited to, all arborist activities brought out in the previous sections. In addition, pruning, as outlined in International Society of Arboriculture Best Management Practices: Pruning and ANSI A300 Part 1 Standard Practices: Pruning, shall be prescribed as necessary. Fertilizing, aeration, irrigation, pest control and other activities shall be prescribed according to the tree needs, local site requirements, and state agricultural pest control laws. All specifications shall be in writing. For pest control operations, consult the local county agricultural commissioner's office for individuals licensed as pest control advisors or pest control operators.

Final inspection: Upon completion of the project, the arborist shall review all work undertaken that may impact the existing trees. Special attention shall be given to cuts and fills, compacting, drainage, pruning and future remedial work. An arborist should submit a final report in writing outlining the ongoing remedial care following the final inspection.

MAINTENANCE RECOMMENDATIONS FOR TREES TO REMAIN

Regular maintenance, designed to promote plant health and vigor, ensures longevity of existing trees. Regular inspections and the necessary follow-up care of mulching, fertilizing, and pruning, can detect problems and correct them before they become damaging or fatal.

Tree Inspection: Regular inspections of mature trees at least once a year can prevent or reduce the severity of future disease, insect, and environmental problems. During tree inspection, four characteristics of tree vigor should be examined: new leaves or buds, leaf size, twig growth, and absence of crown dieback (gradual death of the upper part of the tree). A reduction in the extension of shoots (new growing parts), such as buds or new leaves, is a fairly reliable cue that the tree's health has recently changed. Growth of the shoots over the past three years may be compared to determine whether there is a reduction in the tree's typical growth pattern. Further signs of poor tree health are trunk decay, crown dieback, or both. These symptoms often indicate problems that began several years before. Loose bark or deformed growths, such as trunk conks (mushrooms), are common signs of stem decay. Any abnormalities found during these inspections, including insect activity and spotted, deformed, discolored, or dead leaves and twigs, should be noted and observed closely.

Mulching: Mulch, or decomposed organic material, placed over the root zone of a tree reduces environmental stress by providing a root environment that is cooler and contains more moisture than the surrounding soil. Mulch can also prevent mechanical damage by keeping machines such as lawn mowers and string trimmers away from the tree's base. Furthermore, mulch reduces competition from surrounding weeds and turf. To be most effective, mulch should be placed 2 to 4 inches deep and cover the entire root system, which may be as far as 2 or 3 times the diameter of the branch spread of the tree. If the area and activities happening around the tree do not permit the entire area to be mulched, it is recommended that as much of the area under the drip line of the tree is mulched as possible. When placing mulch, care should be taken not to cover the actual trunk of the tree. This mulch-free area, 1 to 2 inches wide at the base, is sufficient to avoid moist bark conditions and prevent trunk decay. An organic mulch layer 2 to 4 inches deep of loosely packed shredded leaves, pine straw, peat moss, or composted wood chips is adequate. Plastic should not be used as it interferes with the exchange of gases between soil and air, which inhibits root growth. Thicker mulch layers, 5 to 6 inches deep or greater, may also inhibit gas exchange.

Fertilization: Trees require certain nutrients (essential elements) to function and grow. Urban landscape trees may be growing in soils that do not contain sufficient available nutrients for satisfactory growth and development. In certain situations, it may be necessary to fertilize to improve plant vigor. Fertilizing a tree can improve growth; however, if fertilizer is not applied wisely, it may not benefit the tree at all and may even adversely affect the tree. Mature trees making satisfactory growth may not require fertilization. When considering supplemental fertilizer, it is important to consider nutrients deficiencies and how and when to amend the deficiencies. Soil conditions, especially pH and organic matter content, vary greatly, making the proper selection and use of fertilizer a somewhat complex process. To that end, it is recommended that the soil be tested for nutrient content. A soil testing laboratory can give advice on application rates, timing, and the best blend of fertilizer for each tree and other landscape plants on site. Mature trees have expansive root systems that extend from 2 to 3 times the size of the leaf

canopy. A major portion of actively growing roots is located outside the tree's drip line. Understanding the actual size and extent of a tree's root system before applying fertilizer is paramount to determine quantity, type and rate at which to best apply fertilizer. Always follow manufacturer recommendations for use and application.

Pruning: Pruning is often desirable or necessary to remove dead, diseased, or insect-infested branches and to improve tree structure, enhance vigor, or maintain safety. Because each cut has the potential to change the growth of (or cause damage to) a tree, no branch should be removed without reason. Removing foliage from a tree has two distinct effects on growth: (1) it reduces photosynthesis and, (2) it may reduce overall growth. Pruning should always be performed sparingly. Caution must be taken not to over-prune as a tree may not be able to gather and process enough sunlight to survive. Pruning mature trees may require special equipment, training, and experience. Licensed and insured tree maintenance companies are equipped to provide a variety of services to assist in performing the job safely and reducing risk of personal injury and property damage and should be consulted for this type of work. (See also *ANSI A300 Part 1 Pruning Standards*- <https://www.tcia.org>).

Planting and Irrigation: Any new planting and irrigation that is to occur under the drip line of an existing tree should be conducted with care to avoid the root system. Generally installation of an irrigation mainline should be avoided under the dripline of the existing tree. Refer to the Grading/Excavating section for installation of any irrigation lines to be installed under the drip line of an existing tree. Any new planting should match the water use of the existing tree (as defined by WUCOLS). The irrigation hydro zone for the new planting should also match the requirements of the existing tree.

Removal: There are circumstances when removal is necessary. An arborist can help decide whether or not a tree should be removed. Professionally trained arborists have the skills and equipment to safely and efficiently remove trees. Removal is recommended when a tree: (1) is dead, dying, or considered irreparably hazardous; (2) is causing an obstruction or is crowding and causing harm to other trees and the situation is impossible to correct through pruning; (3) is to be replaced by a more suitable specimen, and; (4) should be removed to allow for construction. Pruning or removing trees, especially large trees, can be dangerous work. It should be performed only by those trained and equipped to work safely in trees.

TERMS AND CONDITIONS

The following terms and conditions apply to all oral and written reports and correspondence pertaining to consultations, inspections and activities of HMM.

1. The scope of any report or other correspondence is limited to the trees and conditions specifically mentioned in those reports and correspondence. HMM assumes no liability for the failure of trees or parts of trees, either inspected or otherwise. HMM assumes no responsibility to report on the condition of any tree or landscape feature not specifically requested by the named client.
2. No tree described in this report was climbed, unless otherwise stated. HMM does not take responsibility for any defects, which could have only been discovered by climbing. A full root collar inspection, consisting of excavating the soil around the tree to uncover the root collar and major buttress roots was not performed unless otherwise stated. HMM does not take responsibility for any root defects, which could only have been discovered by such an inspection.
3. HMM shall not be required to provide further documentation, give testimony, be deposed, or attend court by reason of this appraisal or report unless subsequent contractual arrangements are made, including payment of additional fees for such services as described by HMM or in the schedule of fees or contract.
4. HMM guarantees no warranty, either expressed or implied, as to the suitability of the information contained in the reports for any reason. It is the responsibility of the client to determine applicability to his/her case.
5. Any report and the values, observations and recommendations expressed therein represent the professional opinion of HMM, and the fee for services is in no manner contingent upon the reporting of a specified value nor upon any particular finding to be reported.
6. Any photographs, diagrams, graphs, sketches or other graphic material included in any report, being intended solely as visual aids, are not necessarily to scale and should not be construed as engineering reports or surveys, unless otherwise noted in the report. Any reproductions of graphic material or the work produced by other persons, is intended solely for clarification and ease of reference. Inclusion of said information does not constitute a representation by HMM as to the sufficiency or accuracy of that information.
7. Trees can be managed, but they cannot be controlled. To live near trees is to accept some degree of risk. The only way to eliminate all risk associated with trees is to eliminate all trees.

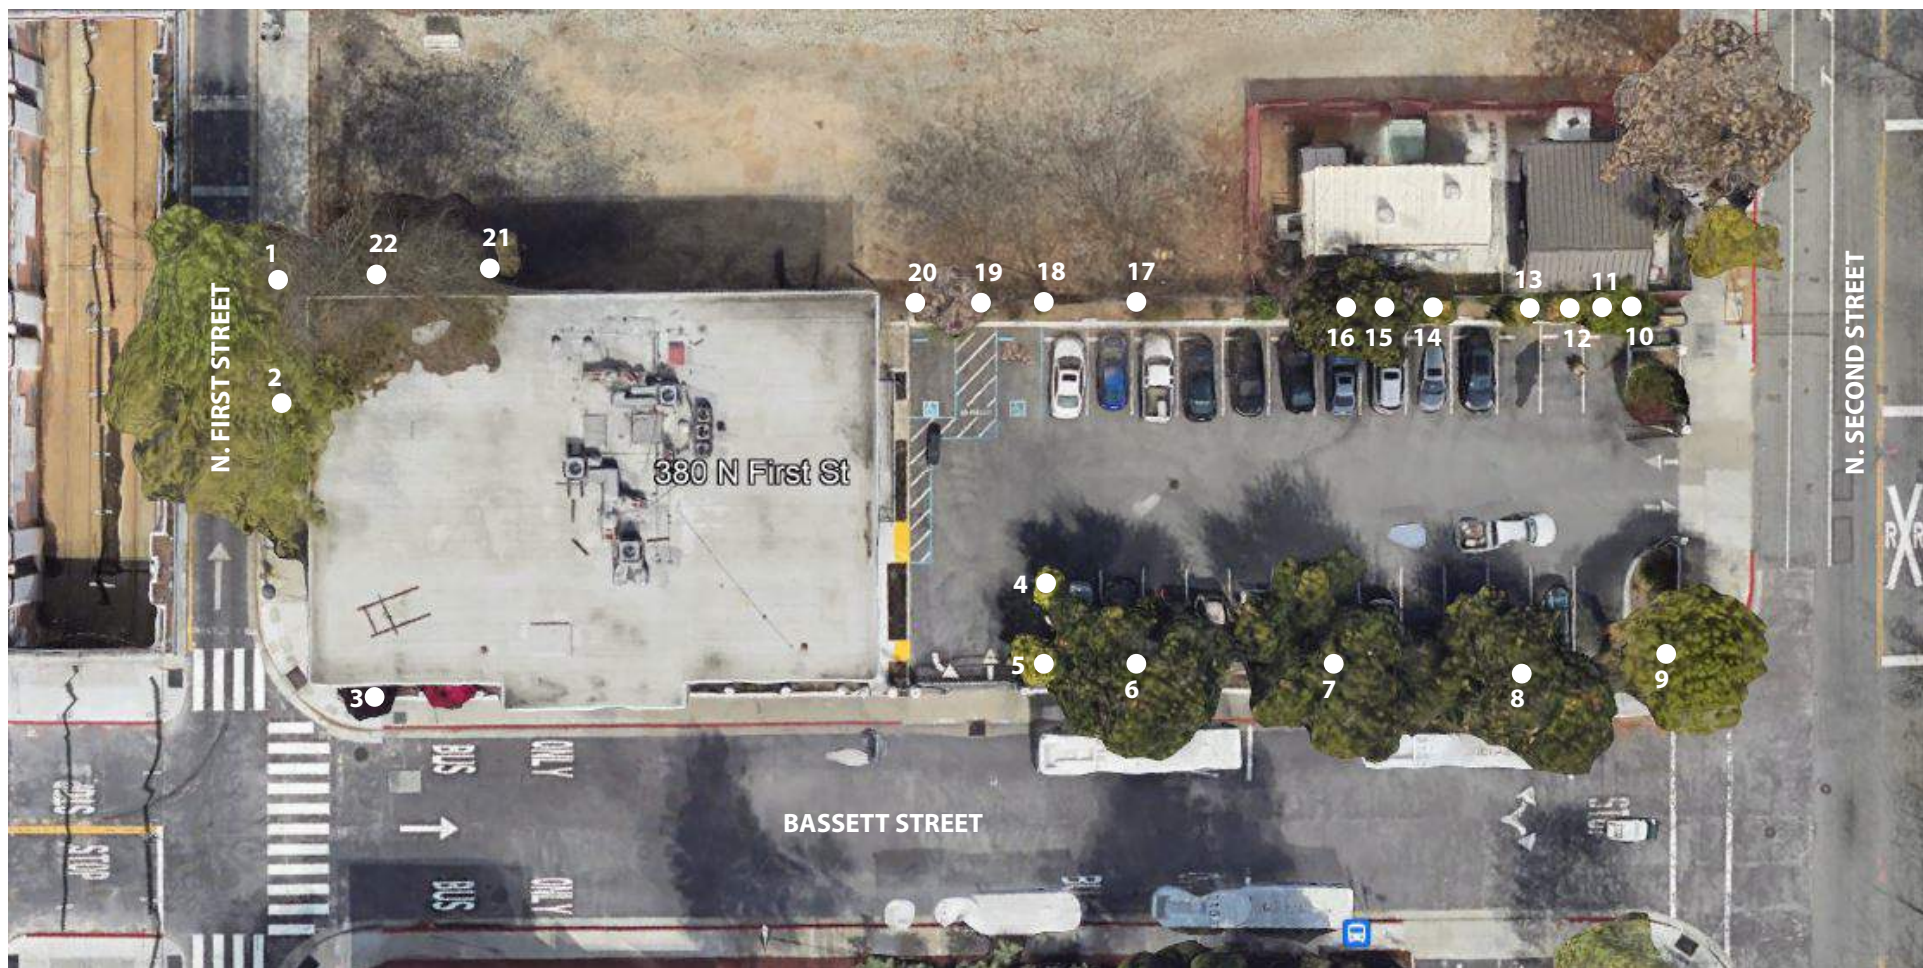


TABLE 1 - TREE QUANTITY SUMMARY

Tree Quantity by Species		
Species	Quantity	% of Site
Ailanthus altissima	6	27%
Ceratonia siliqua	3	14%
Citrus sp.	4	18%
Ficus benjamina	1	5%
Persea americana	2	9%
Platanus x hispanica	2	9%
Prunus cerasifera	1	5%
Prunus sp.	1	5%
Pyrus sp.	1	5%
Quercus ilex	1	5%
Total Trees	22	100%

TABLE 2 - TREE EVALUATION SUMMARY

Prepared By: William Sowa ISA Certified Arborist WE-12270A


DBH MEASUREMENT HEIGHT: 54"

Date of Evaluation: 2/15/2023

Suitability for Preservation is based on the following		
Good - Trees with good health and structural stability that have the potential for longevity at the site.		
Moderate - Trees in somewhat declining health and/or exhibits structural defects that cannot be abated with treatment. Trees will require more intense management and will have a shorter lifespan than those in the 'Good' category.		
Poor - Trees in poor health or with significant structural defects that cannot be mitigated. Tree is expected to decline, regardless of treatment.		
Health Rating		
5	A healthy, vigorous tree, reasonably free of disease, with good structure and form typical of the species.	
4	A tree with slight decline in vigor, small amount of twig dieback, minor structural defects that could be corrected.	
3	A tree with moderate vigor, moderate twig and small branch dieback, thinning of crown, poor leaf color, moderate structural defects that may that might be mitigated with care.	
2	A tree in decline, epicormic growth, extensive dieback of medium to large branches, significant structural defects that cannot be abated.	
1	A tree in severe decline, dieback of scaffold branches and or trunk, mostly epicormic growth; extensive structural defects that cannot be abated.	
0	Tree is dead.	
Abbreviations and Definitions		
CD	Codominant branches	Forked branches nearly the same size in diameter, arising from a common junction an lacking a normal branch union.
CDB	Dieback in Crown	Condition where branches in the tree crown die from the tips toward the center.
CR	Crowded	Tree is bounded closely by one or more of the following: structure, tree, Etc.
D	Decline	Tree shows obvious signs of decline, which may be indicative of the presence of multiple biotic and abiotic disorders.
DBH	Diameter at Breast Height	Measurement of tree diameter in inches. Measurement height varies by City and is noted above.
EG	Epicormic Growth	Watersprouting on trunk and main leaders. Typically indicative of tree stress.
EH	Exposed Heartwood	Exposure of the tree's heartwood is typically seen as an open wound that leaves a tree more susceptible to pathogens, disease or infection.
H	Hazardous	A tree that in it's current condition, presents a hazard.
HD	Headed	Poor pruning practice of cutting back branches. Often practiced under utility lines to limit tree height.
IB	Included Bark	Structural defect where bark is included between the branch attachment so the wood can't join. Such defect can have a higher probability of failure.
LN	Leaning Tree	Tree leaning, see notes for severity.
MT	Multi Trunk	Multiple central leaders originating below the DBH measurement.
PT	Phototropism	Tree exhibits phototropic growth habits. Reduced trunk taper, misshapen trunk and canopy growth are examples of this growth habit.
S	Suckers	Shoot arising from the roots.
SD	Structural Defects	Naturally or secondary conditions including cavities, poor branch attachments, cracks, or decayed wood in any part of the tree that may contribute to structural failure.
SE	Severe	Indicates the severity of the following term.
SL	Slight	Indicates the mildness of the following term.
SR	Surface Roots	Roots visible at finished grade.
ST	Stress	Environmental factor inhibiting regular tree growth. Includes drought, salty soils, nitrogen and other nutrient deficiencies in the soil.
WU	Weak Union	Weak union or fork in tree branching structure.
	Ordinance Tree	Ordinance-Size Trees. An ordinance-size tree is: Single Trunk - 38 inches or more in circumference at 4 ½ feet above ground; or Multi-trunk - The combined measurements of each trunk circumference (at 4 ½ feet above ground) add up to 38 inches or more.

TREE #	BOTANICAL NAME	COMMON NAME	DBH (INCHES)	CIRCUMFERENCE (INCHES)	ORDINANCE TREE	NATIVE/NON-NATIVE/ORCHARD	REPLACEMENT RATIO	CANOPY (APX FEET)	HEIGHT (APX FEET)	HEALTH	PRESERVATION SUITABILITY	NOTES
1	<i>Platanus x hispanica</i>	London Plane Tree	13.5	42	YES	Non-Native	4:1	25	40	3	Moderate	Street Tree, CR tree grate
2	<i>Platanus x hispanica</i>	London Plane Tree	17.0	53	YES	Non-Native	4:1	30	40	3	Moderate	Street Tree, SL LN, SL CR building, CR tree grate
3	<i>Prunus cerasifera</i>	Purpleleaf Plum	5.5, 2.5	25	NO	Non-Native	2:1	10	10	3	Moderate	MT, Cactus infestation
4	<i>Persea americana</i>	Avocado	2.3	7	NO	Orchard	NONE	3	10	3	Moderate	SL LN, SD
5	<i>Persea americana</i>	Avocado	3.6	11	NO	Orchard	NONE	6	15	3	Moderate	CR by tree #6
6	<i>Ceratonia siliqua</i>	Carob	32.1	101	YES	Non-Native	4:1	30	22	3	Moderate	SD, SR, hollow, EHW, CR by wall/fence
7	<i>Ceratonia siliqua</i>	Carob	32.3	101	YES	Non-Native	4:1	35	25	3	Moderate	CR by wall/fence, SR
8	<i>Ceratonia siliqua</i>	Carob	23.3	73	YES	Non-Native	4:1	30	22	3	Moderate	CR by wall/fence, SR, SD, Decay
9	<i>Ficus benjamina</i>	Weeping Fig	4.7, 5, 10.1, 5.3, 8.2	105	YES	Non-Native	4:1	25	22	2	Poor	CDB, ST, SD, MT, SR
10	<i>Prunus sp.</i>	Cherry	3.0	9	NO	Orchard	NONE	4	6	3	Moderate	SD, LN, CR by tree #11
11	<i>Citrus sp.</i>	Citrus	2.9, 1.9, 2.5, 2.7	31	NO	Orchard	NONE	6	12	3	Moderate	MT, SD, CDB
12	<i>Citrus sp.</i>	Citrus	2.4, 1.1, 1.2, 2.1, 2.5	29	NO	Orchard	NONE	5	10	3	Moderate	MT, SD, CDB
13	<i>Citrus sp.</i>	Citrus	1.2, 1.7, 1.1, 1, 1.5, 1, 1.7	29	NO	Orchard	NONE	3	8	2	Poor	MT, CDB, D
14	<i>Citrus sp.</i>	Citrus	1.7, 1.5, 1.2, 1.1	17	NO	Orchard	NONE	5	10	3	Moderate	MT, CDB
15	<i>Pyrus sp.</i>	Pear	3, 1.5, 1.5	19	NO	Orchard	NONE	8	10	3	Moderate	MT, LN, CR by tree #16
16	<i>Quercus ilex</i>	Holly Oak	12.4	39	YES	Non-Native	4:1	22	20	3	Moderate	SD, black sooty mold
17	<i>Ailanthus altissima</i>	Tree of Heaven	12.3, 17.4	93	YES	Non-Native/ Invasive	4:1	24	35	2	Poor	CR by fence, bark peeling, SD, invasive
18	<i>Ailanthus altissima</i>	Tree of Heaven	12, 4, 2.5	58	YES	Non-Native/ Invasive	4:1	18	32	2	Poor	CR by fence, bark peeling, burn scars, invasive
19	<i>Ailanthus altissima</i>	Tree of Heaven	8.6, 9.2, 10.8, 6.7	111	YES	Non-Native/ Invasive	4:1	24	28	2	Poor	CR by fence, bark peeling, invasive
20	<i>Ailanthus altissima</i>	Tree of Heaven	4.0	13	NO	Non-Native/ Invasive	4:1	12	5	2	Poor	SD, growing through fence, invasive


TREE #	BOTANICAL NAME	COMMON NAME	DBH (INCHES)	CIRCUMF- ERENCE (INCHES)	ORDINANCE TREE	NATIVE/NON- NATIVE/ORCHARD	REPLACEMENT RATIO	CANOPY (APX FEET)	HEIGHT (APX FEET)	HEALTH	PRESERVATION SUITABILITY	NOTES
21	<i>Ailanthus altissima</i>	Tree of Heaven	13.8, 13.1, 10.1	116	YES	Non-Native/ Invasive	4:1	20	40	2	Poor	SD, growing through fence, invasive
22	<i>Ailanthus altissima</i>	Tree of Heaven	13.0	41	YES	Non-Native/ Invasive	4:1	20	40	2	Poor	CR by gas meter, utilities, invasive

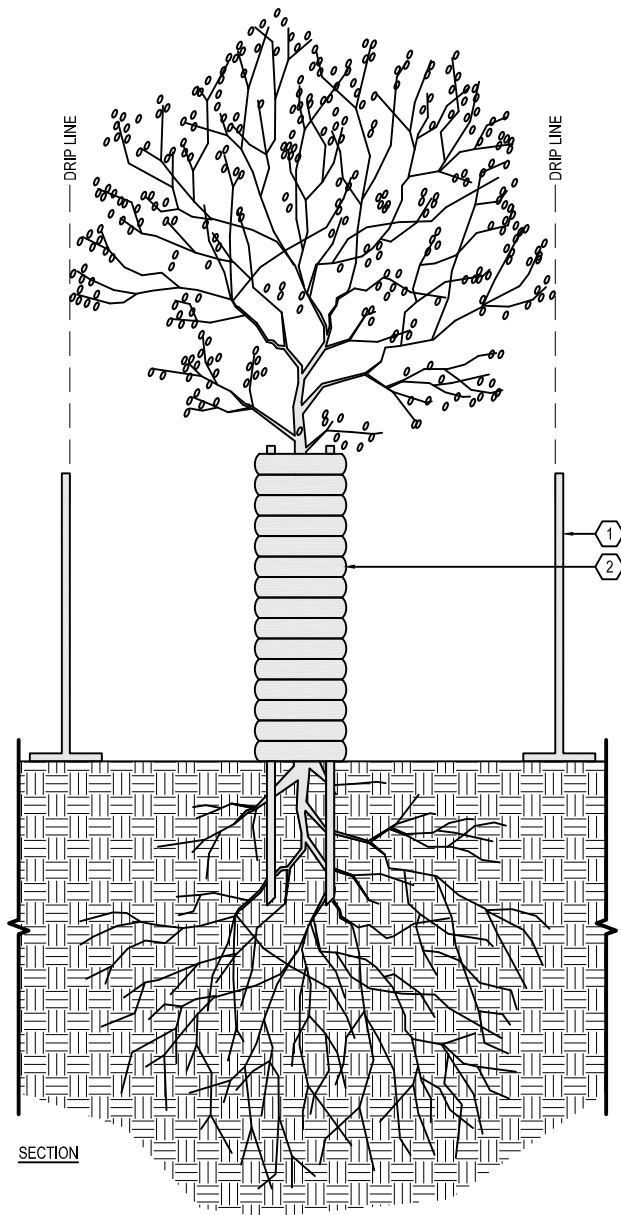

NOTES:




1. REFER TO THE TREE PROTECTION NOTES.
2. TREE PROTECTION MEASURES SHALL BE INSTALLED BEFORE GRADING OR EQUIPMENT IS ALLOWED ON SITE.
3. PRIOR TO CONSTRUCTION, SEE THE REMEDIAL REPAIRS SECTION TO DETERMINE FERTILIZING AND WATERING SCHEDULES FOR EXISTING TREES.
4. WHEN CONSTRUCTION IS TO TAKE PLACE WITHIN A TREE'S DRIP LINE, SEE SITE PREPARATION SECTION.
5. NO CONSTRUCTION WASTE, EITHER LIQUID, SOLID, OR ANY OTHER SUBSTANCE WHICH COULD ENTER INTO THE ROOT SYSTEM (OIL, GASOLINE, CHEMICALS, OR OTHER HARMFUL MATERIALS) SHALL BE DEPOSITED, DISPOSED OF, OR STORED WITHIN OR NEAR A TREE'S DRIP LINE.
6. WIRE, SIGNS, ROPES, PULLEYS, ETC., SHALL NOT BE ATTACHED TO ANY TREE.
7. IF TRENCHING WITHIN A TREE'S DRIP LINE IS NECESSARY, SEE GRADING/EXCAVATION SECTION.
8. IF TREE PRUNING IS NECESSARY, SEE REMEDIAL REPAIRS SECTION.
9. INSTALL ONE SIGN TO DRIP LINE FENCING PER AREA.
10. SEE TREE PROTECTION ZONE (TPZ) INSTRUCTIONS UNDER SITE PREPARATION SECTION.


- ① 6'-0" HIGH TEMPORARY CHAIN LINK FENCE, INSTALLED AT DRIP LINE. SEE TREE PROTECTION PLAN FOR LOCATIONS. PREFERENCE WOULD BE AT DRIP LINE OR FOLLOW LOCAL CODES.
- ② INSTALL TRUNK WRAP IF DRIP LINE FENCE IS NOT PRACTICAL, INSTALL FOUR (4) LODGE POLES AROUND EACH TREE, WRAP TRUNK IN STRAW WADDLE, THEN WRAP IN ORANGE SNOW FENCING UP TO BRANCHING STRUCTURE






SIGN
SCALE: 1" = 1'-0"


TREE PROTECTION
SCALE: 1/2" = 1'-0"

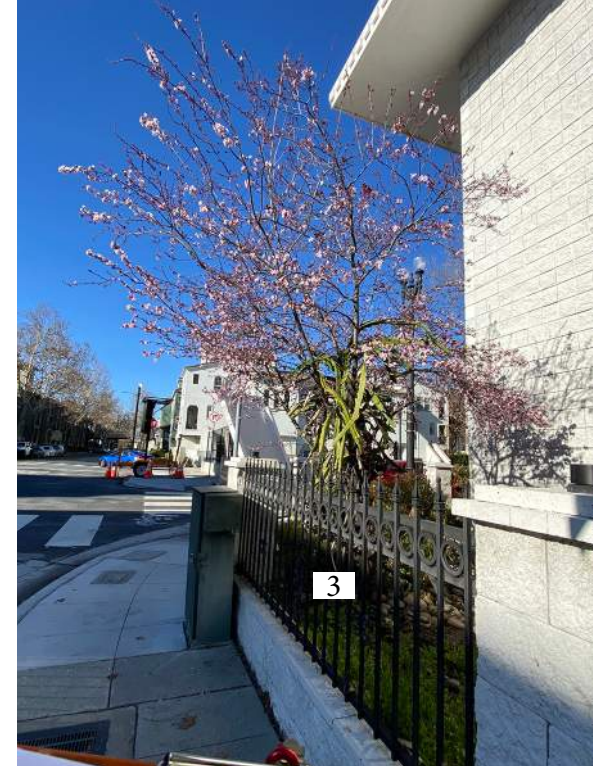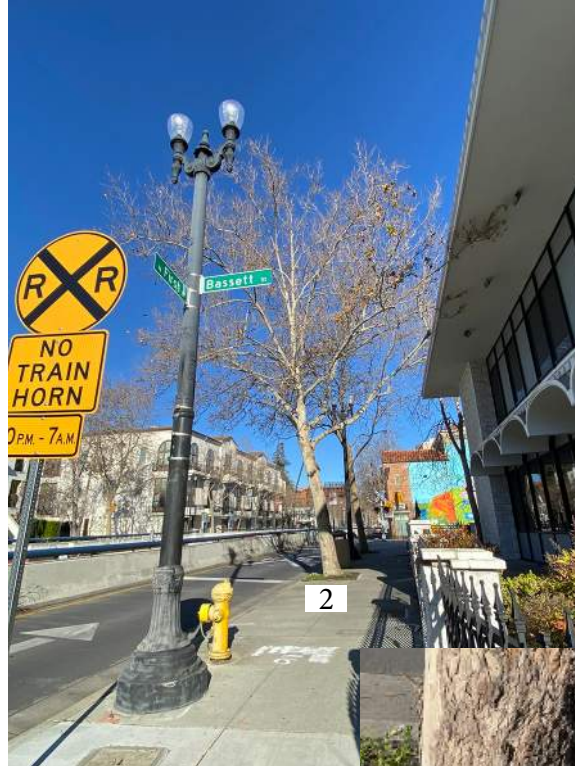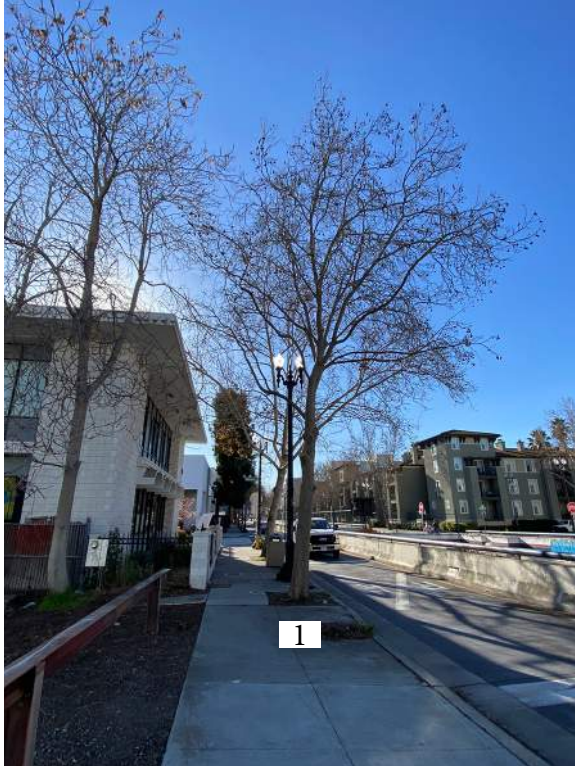

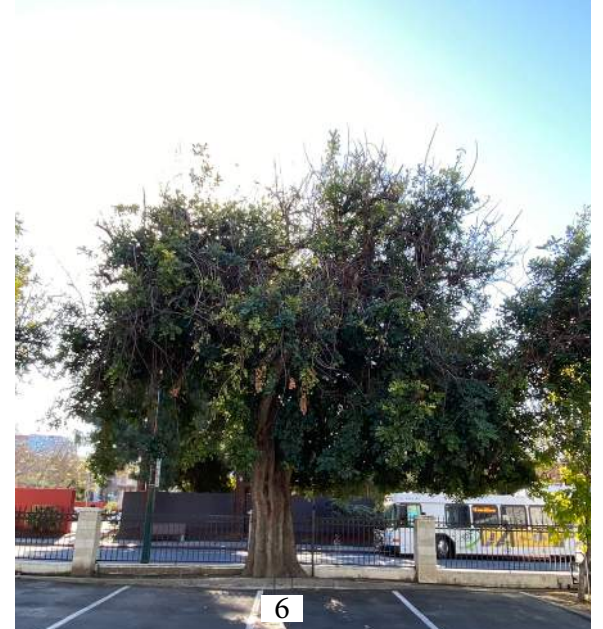

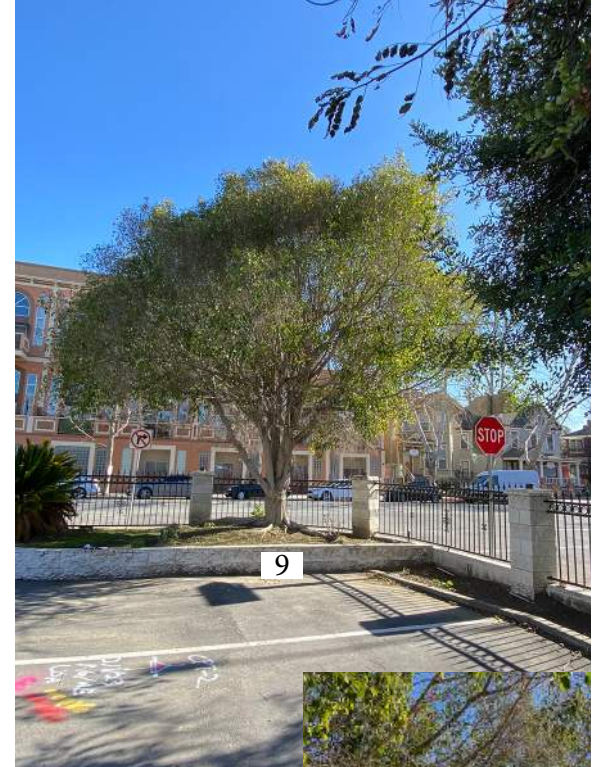

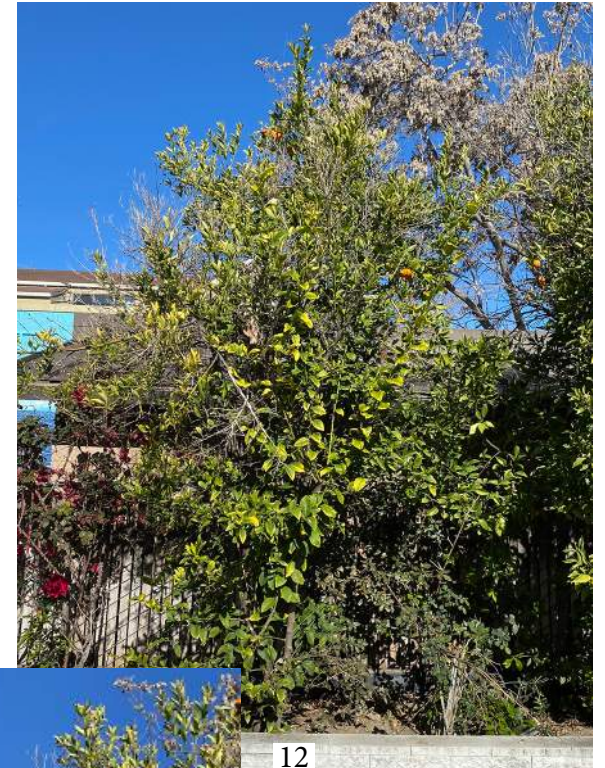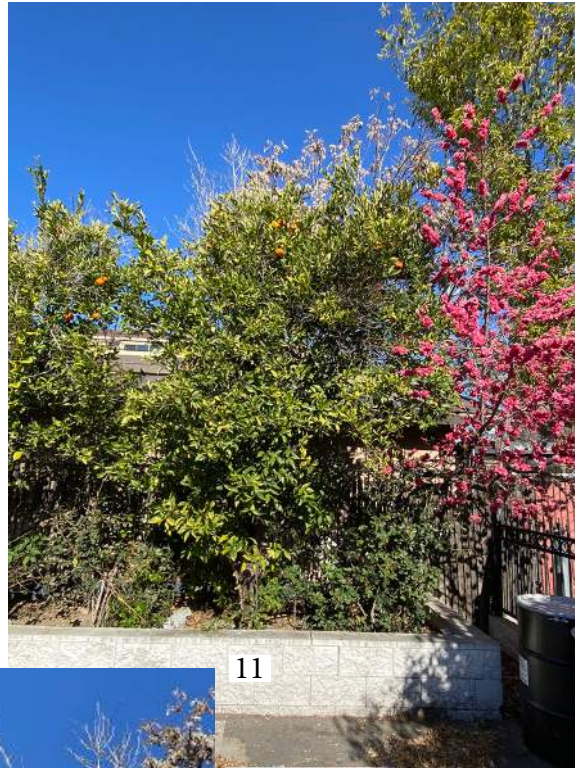


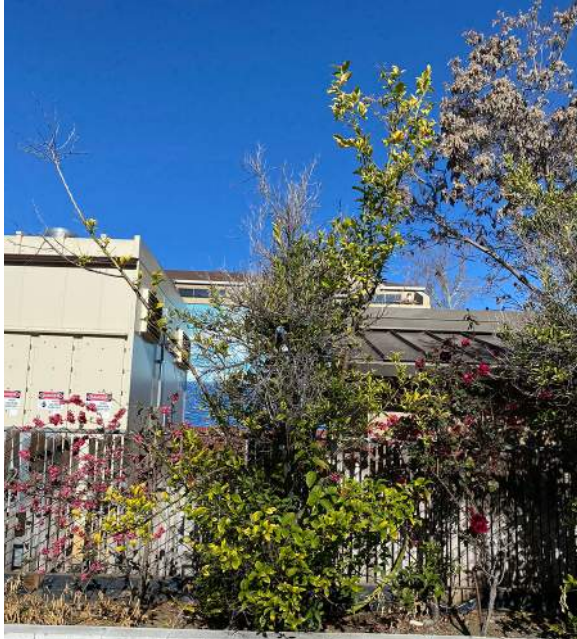

13



14

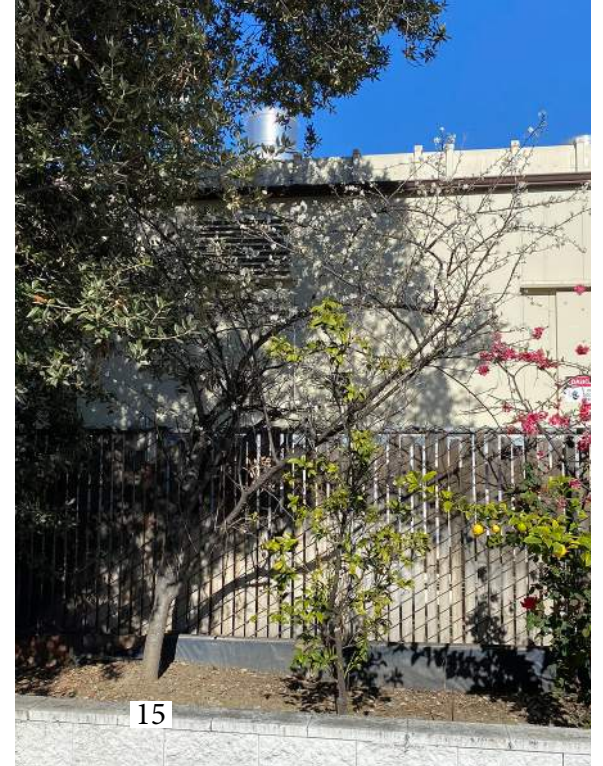

15

